



# COUPLE6 ALIGNMENT REPORT




## REPORT ISSUED BY:

9 Mechanics co.,ltd  
1/99 moo12 Bangpheeeyai Bangphee Samuthprakan  
02-751-0755 , 086-667-8789

## COMPANY / JOB INFORMATION

Machine Name            MOTOR PUMP 160KW. 2978RPM PP1  
Company Name            Amita (Thailand)  
Location  
Address  
  
City  
State  
Postal Code(ZIP)  
Country  
Notes

## MACHINE SETUP

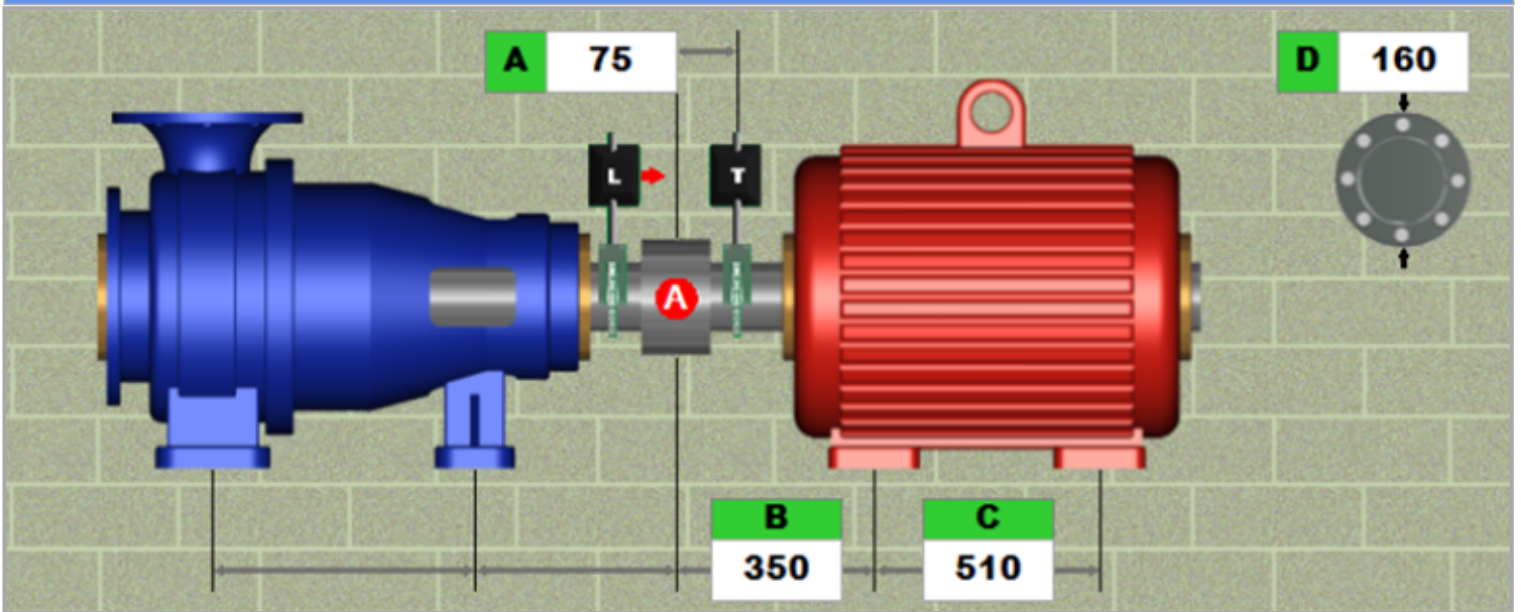

UNITS

OFFSET = mm, ANGLE = mm/100mm




## TARGET INFORMATION

MODEL NUMBER :  
Calib. Due : September 2018

Serial Number : 80-00256  
FW REV. : 3.217

# ALIGNMENT RESULTS

## SIDE VIEW / VERT.

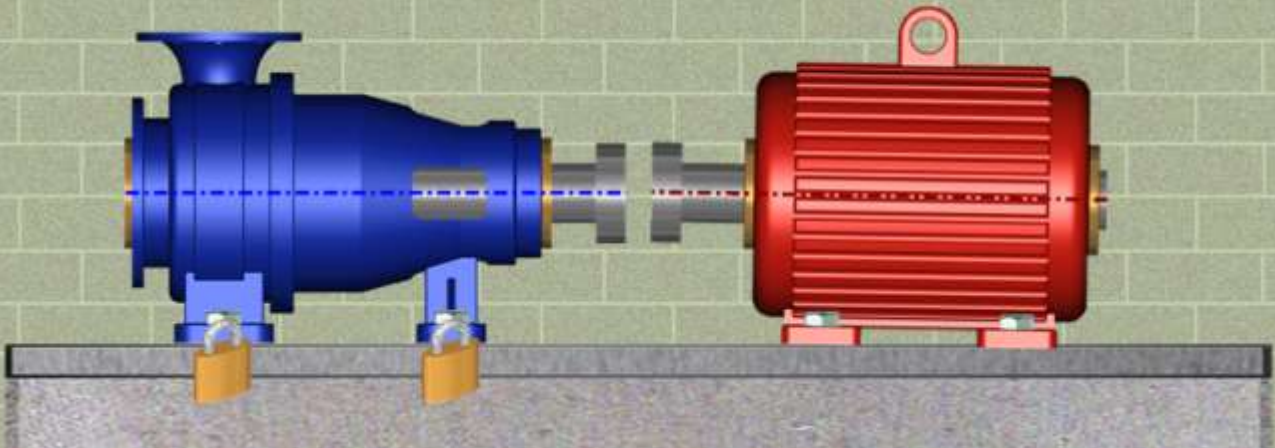

**GAP**


**-0.03**

| RPM    | TOLERANCES |          |
|--------|------------|----------|
|        | ACCE...    | EXCEL... |
| 1200+  |            |          |
| OFFSET | 0.10       | 0.06     |
| ANGLE  | 0.08       | 0.05     |
| GAP    | 0.13       | 0.08     |

**OFFSET**

**0.01**

## TOP VIEW / HORIZ.

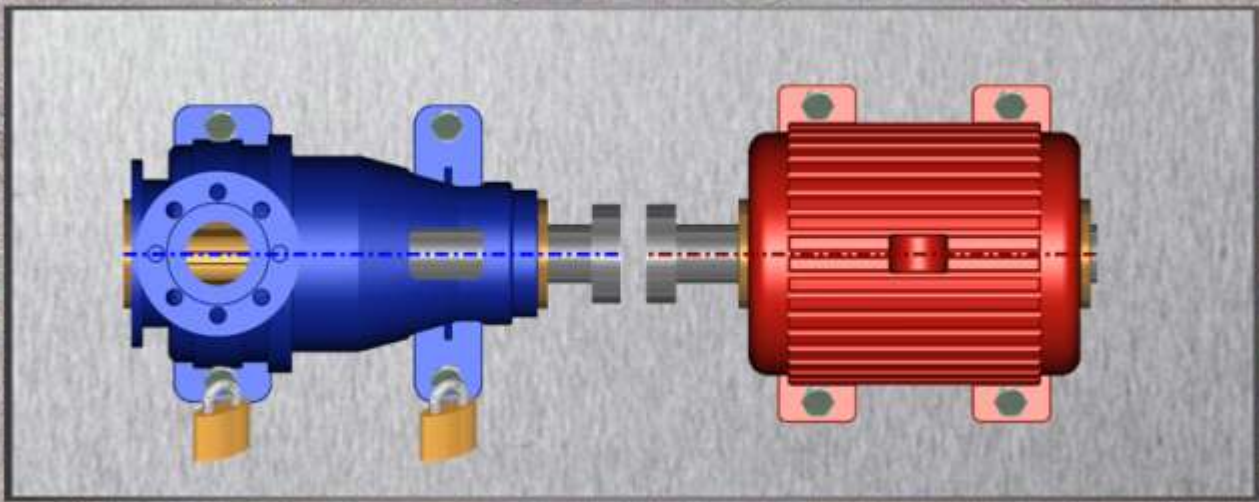

**GAP**

**0.01**


| RPM    | TOLERANCES |          |
|--------|------------|----------|
|        | ACCE...    | EXCEL... |
| 1200+  |            |          |
| OFFSET | 0.10       | 0.06     |
| ANGLE  | 0.08       | 0.05     |
| GAP    | 0.13       | 0.08     |

**OFFSET**

**0.02**

# SOFT FOOT

| FOOT | TIGHT | LOOSE | CHAN... | NOTES |
|------|-------|-------|---------|-------|
| 1    | ---   | ---   | ---     | N/A   |
| 2    | ---   | ---   | ---     | N/A   |
| 3    | ---   | ---   | ---     | N/A   |
| 4    | ---   | ---   | ---     | N/A   |

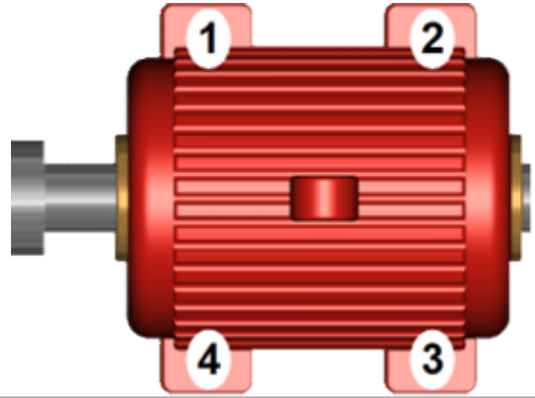

# REPEATABILITY

| #   | V Offset | V Gap | H Offset | H Gap | DATE      | TIME     | SPAN   | #POINTS | MODE    | METHOD     |
|-----|----------|-------|----------|-------|-----------|----------|--------|---------|---------|------------|
| ✓ 1 | 0.01     | -0.03 | 0.02     | 0.01  | 4/15/2022 | 10:28 PM | 357.7° | 23      | Coupled | Auto Clock |



