



COUPLE6 ALIGNMENT REPORT



REPORT ISSUED BY:


9 Mechanics co.,ltd
1/99 moo12 Bangpheeayai Bangphee Samuthprakan
02-751-0755 , 086-667-8789

COMPANY / JOB INFORMATION

Machine Name MOTOR PUMP 160KW. PP2
Company Name Amita (Thailand)
Location
Address

City
State
Postal Code(ZIP)
Country
Notes

MACHINE SETUP

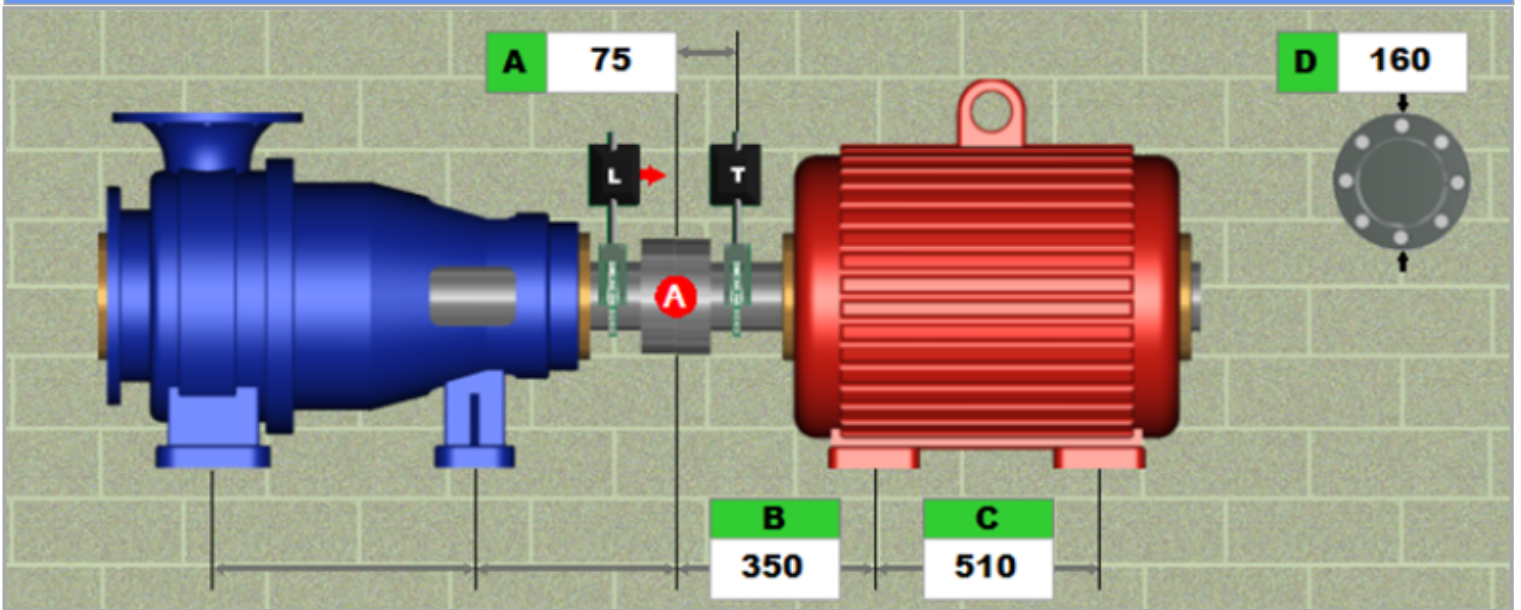

UNITS

OFFSET = mm, ANGLE = mm/100mm




TARGET INFORMATION

MODEL NUMBER :
Calib. Due : September 2018

Serial Number : 80-00256
FW REV. : 3.217

ALIGNMENT RESULTS

SIDE VIEW / VERT.

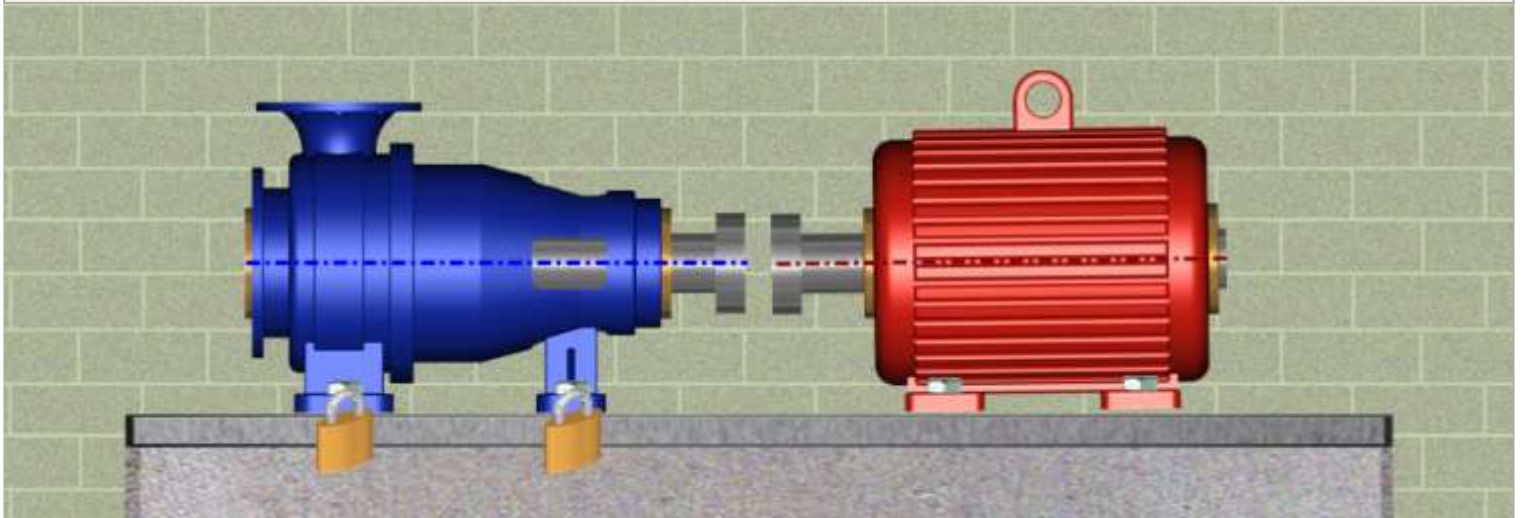

GAP



0.02

RPM	TOLERANCES	
	ACCE...	EXCEL...
1200+		
OFFSET	0.10	0.06
ANGLE	0.08	0.05
GAP	0.13	0.08

OFFSET

-0.01

TOP VIEW / HORIZ.

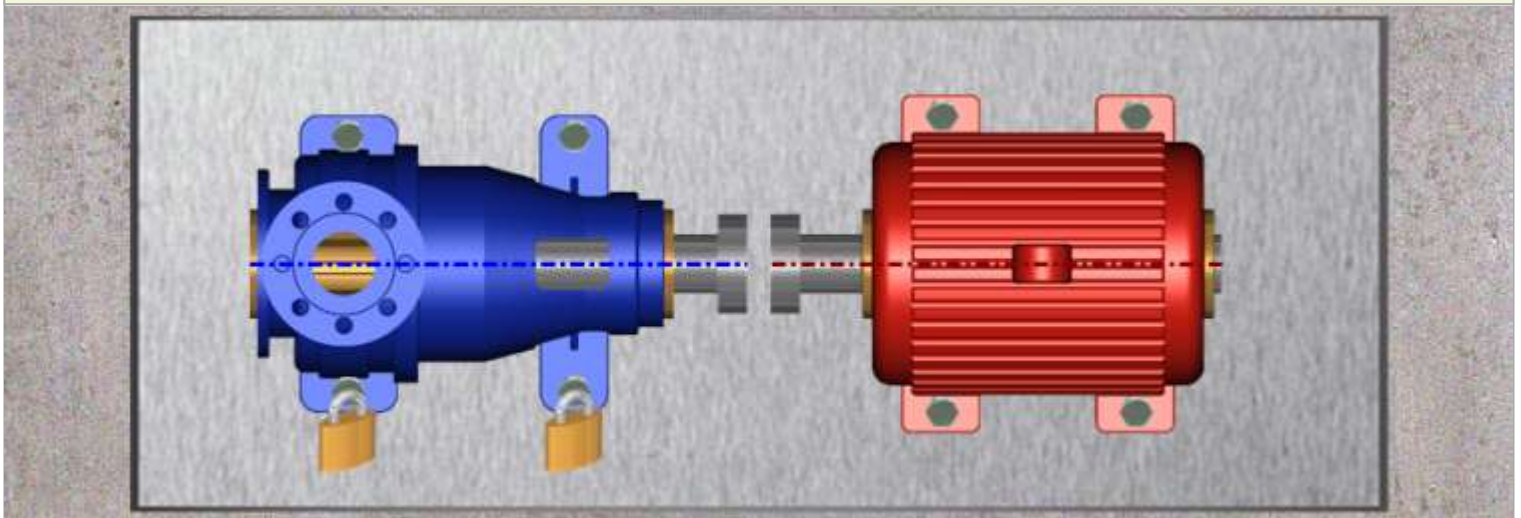

GAP

0.03


RPM	TOLERANCES	
	ACCE...	EXCEL...
1200+		
OFFSET	0.10	0.06
ANGLE	0.08	0.05
GAP	0.13	0.08

OFFSET

0.01

SOFT FOOT

FOOT	TIGHT	LOOSE	CHAN...	NOTES
1	-1.89	-1.88	0.01	
2	-5.09	-4.99	0.11	
3	-5.09	-5.11	-0.02	
4	-1.88	-1.68	0.21	*SHIM

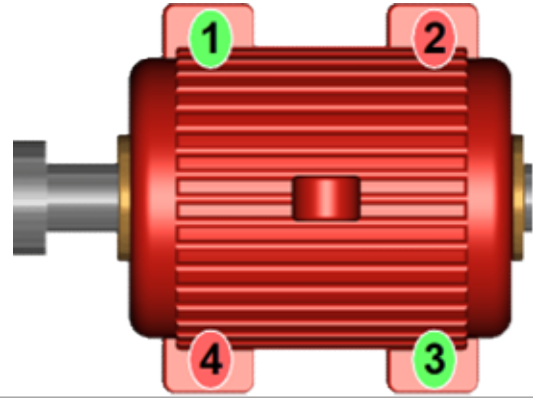

REPEATABILITY

#	V Offset	V Gap	H Offset	H Gap	DATE	TIME	SPAN	#POINTS	MODE	METHOD
✓ 1	-0.01	0.02	0.01	0.03	4/15/2022	4:09 PM	356.6°	43	Coupled	Auto Clock

